

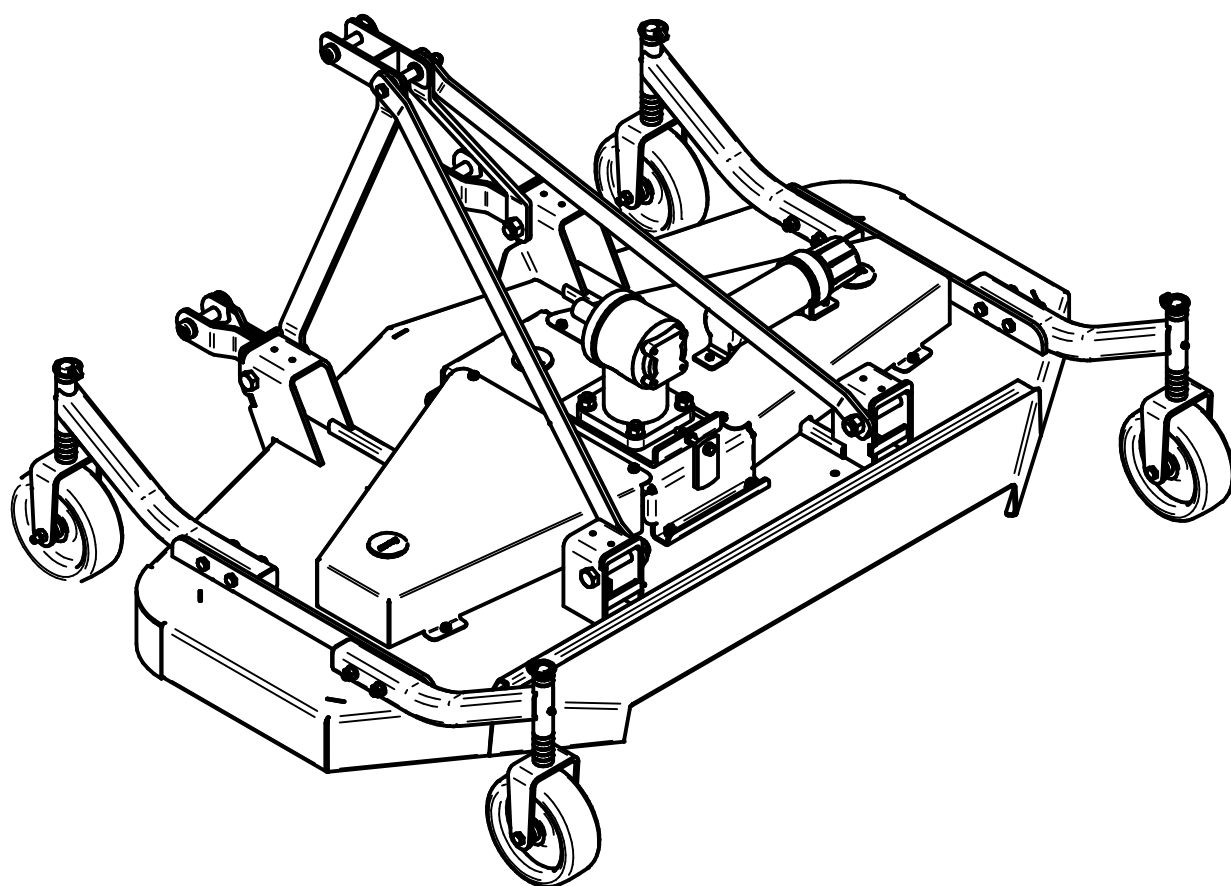


PART'S MANUAL GROOMING MOWER SERIES

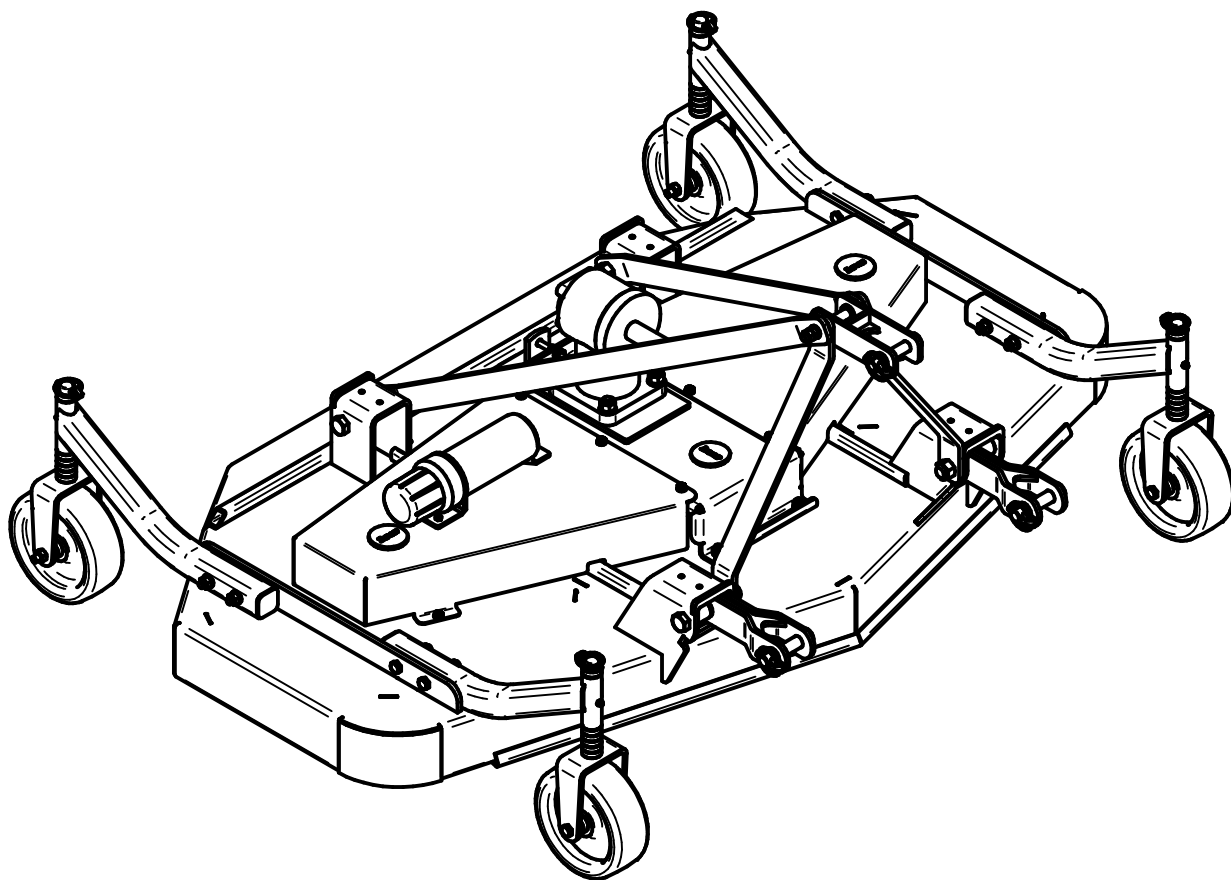

PART LIST FOR TOP MAST WITH FRAME			
Item No	Part No	Description	QTY
1	20001 200 001A	MAIN FRAME WA GM 120	1
	20001 200 001B	MAIN FRAME WA GM 150	1
	20001 200 001C	MAIN FRAME WA GM 180	1
	20001 200 001D	MAIN FRAME WA GM 210	1
2	20001 400 001A	TOP MAST PLATE FRONT SIDE GM 120	1
	20001 400 001B	TOP MAST PLATE FRONT SIDE GM 150	1
	20001 400 001C	TOP MAST PLATE FRONT SIDE GM 180	1
	20001 400 001D	TOP MAST PLATE FRONT SIDE GM 210	1
3	20001 400 002A	TOP MAST BACK PLATE GM 120	1
	20001 400 002B	TOP MAST BACK PLATE GM 150	1
	20001 400 002C	TOP MAST BACK PLATE GM 180	1
	20001 400 002D	TOP MAST BACK PLATE GM 210	1
4	20001 200 007	BOTTOM LINK BRACKET	2
5	20001 200 008	TOP LINK BRACKET	1
6	20001 000 018	SPACER FOR BOTTOM LINK BRACKET	2
7	9122001	Hex Bolt M20 x 1.5 X 130 HT 8.8 Zn D960	4
8	9132003	Nylock Nut M20 x 1.5-8 Zp D982	4
9	9111215	Hex Bolt M12 x 140HT 8.8 Zn D931	1
10	9141202	Washer M12 Zn D125A	1
11	9131201	Hex Nut M12-8 Zp D934	1
12	20001 000 019	SPACER FOR TOP LINK BRACKET	1
13	9131202	Nylock Nut M12-8 Zp D982	1
14	9172203	Pin D 22 x 100	2
15	9171001	Linch Pin 10 x 50	3
16	9171902	Pin D 19 x 100	1


PART LIST FOR TOP MAST WITH FRAME

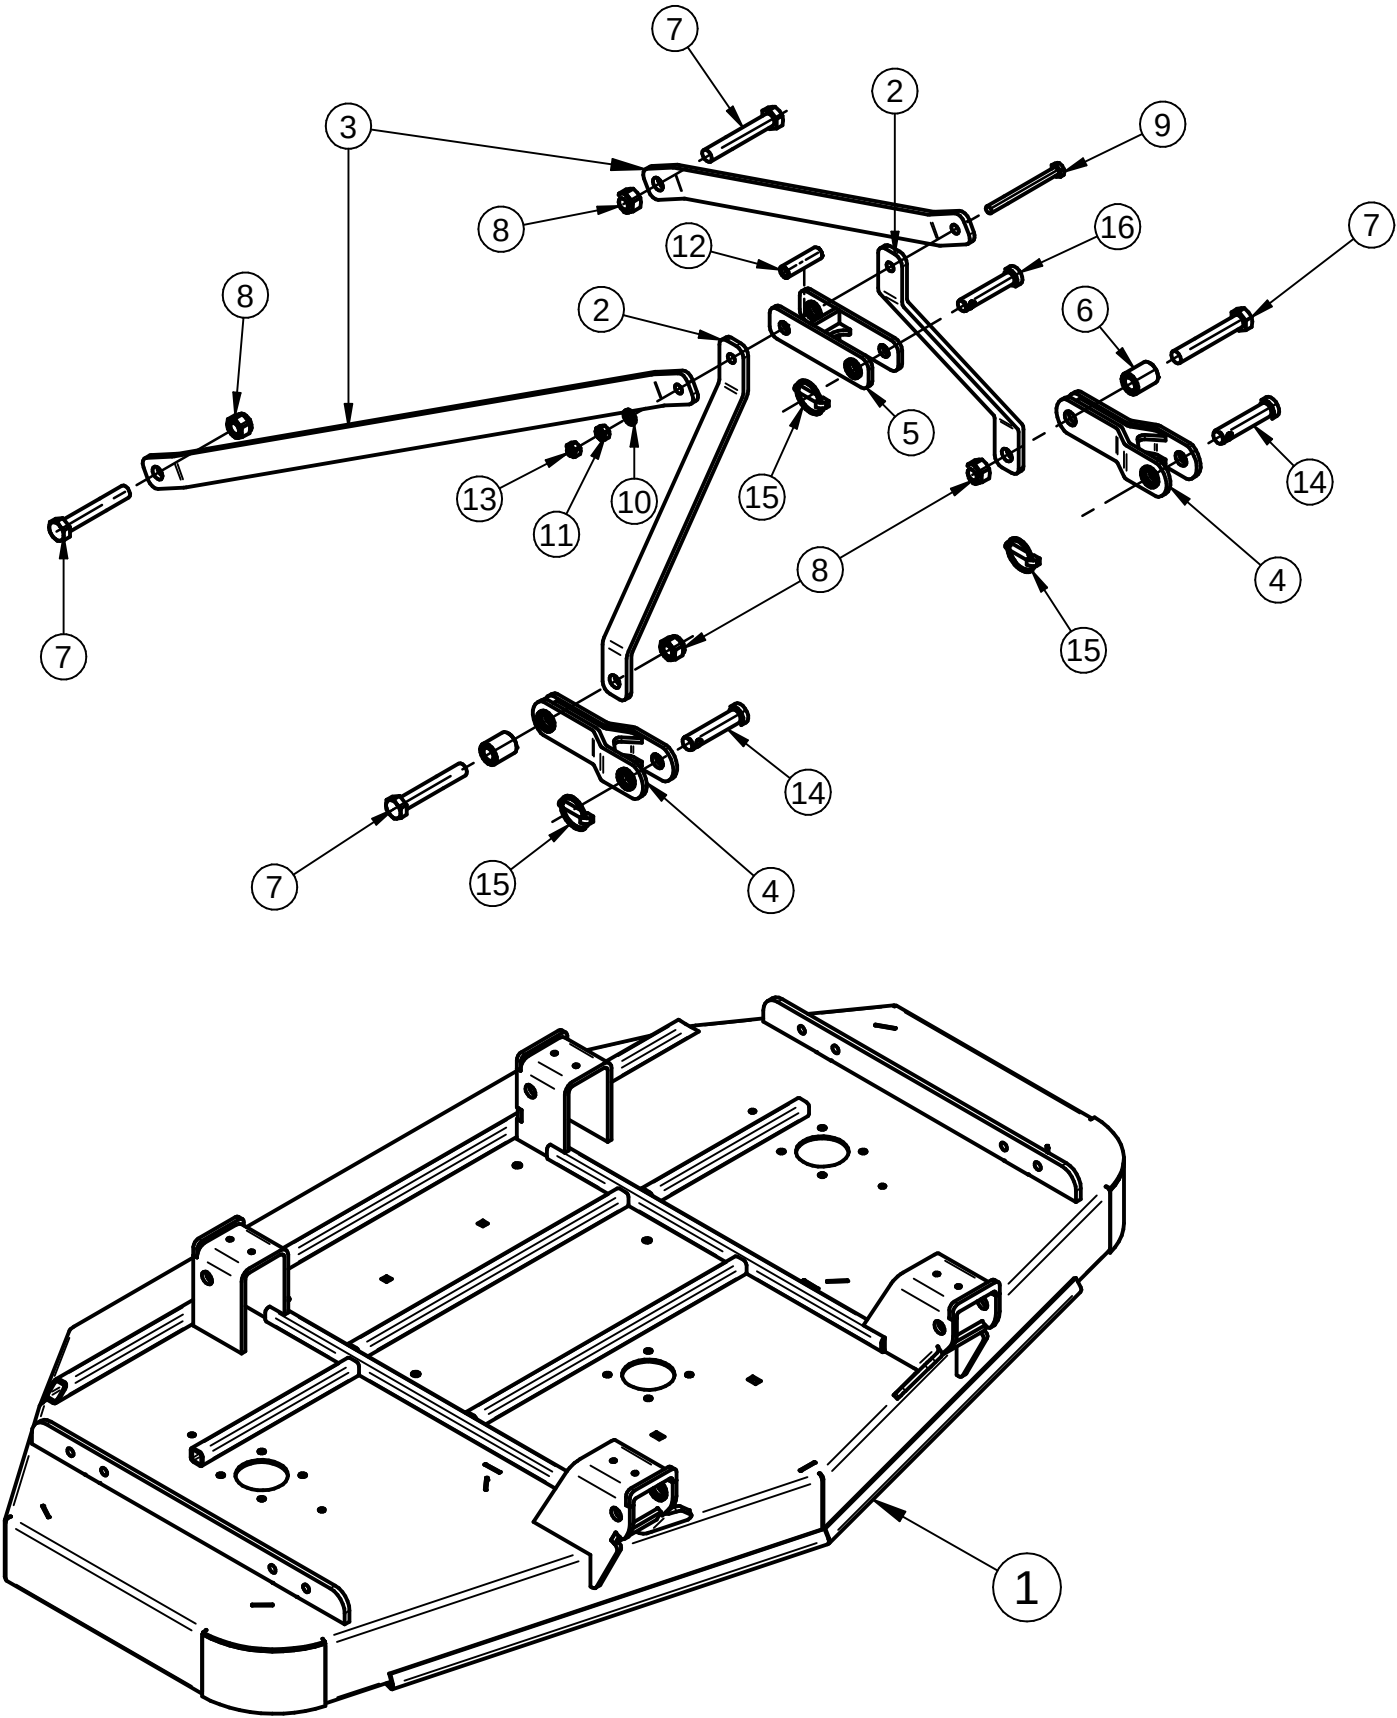

PART LIST FOR FRAME WITH DRIVE COVER

Item No	Part No	Description	QTY
1	20001 200 002	GEARBOX SUPPORT BRACKET WA	1
2	9071001	Mushroom Head SQ. Neck Bolt M10 x 25 lg 8.8 Zn D603	4
3	9141002	Washer M10 Zn D125A	5
4	9131002	Nylock Nut M10-8 Zp D982	5
5	20001 400 003	BELT TENSION PLATE	1
6	9131001	Hex Nut M10-8 Zp D934	2
7	9101011	Hex Bolt M10 x 80 8.8 Zn D933	1
8	20001 000 020	GEARBOX 9.211.803.00HS	1
9	9071605	Mushroom Head SQ. Neck Bolt M16 x 60 lg 8.8 Zn D603	4
10	9141602	Washer M16 Zn D125A	4
11	9131602	Nylock Nut M16-8 Zp D982	4
12	20001 000 021	PARALLEL KEY A 10 X 8 X 40	1
13	20001 200 006A	DRIVE COVER L.H WA GM 120	1
	20001 200 006B	DRIVE COVER L.H WA GM 150	1
	20001 200 006C	DRIVE COVER L.H WA GM 180	1
	20001 200 006D	DRIVE COVER L.H WA GM 210	1
14	20001 300 027A	DRIVE COVER R.H GM 120	1
	20001 300 027B	DRIVE COVER R.H GM 150	1
	20001 300 027C	DRIVE COVER R.H GM 180	1
	20001 300 027D	DRIVE COVER R.H GM 210	1
15	9140802	Washer M8 Zn D125A	10
16	9100803	Hex Bolt M8 x 20 8.8 Zn D933	10
17	9196001	MANUAL BOX	1
18	9100602	Hex Bolt M6 x 16 8.8 Zn D933	3
19	1304002	End Cap plastic Dia 60	3


PART LIST FOR FRAME WITH DRIVE COVER

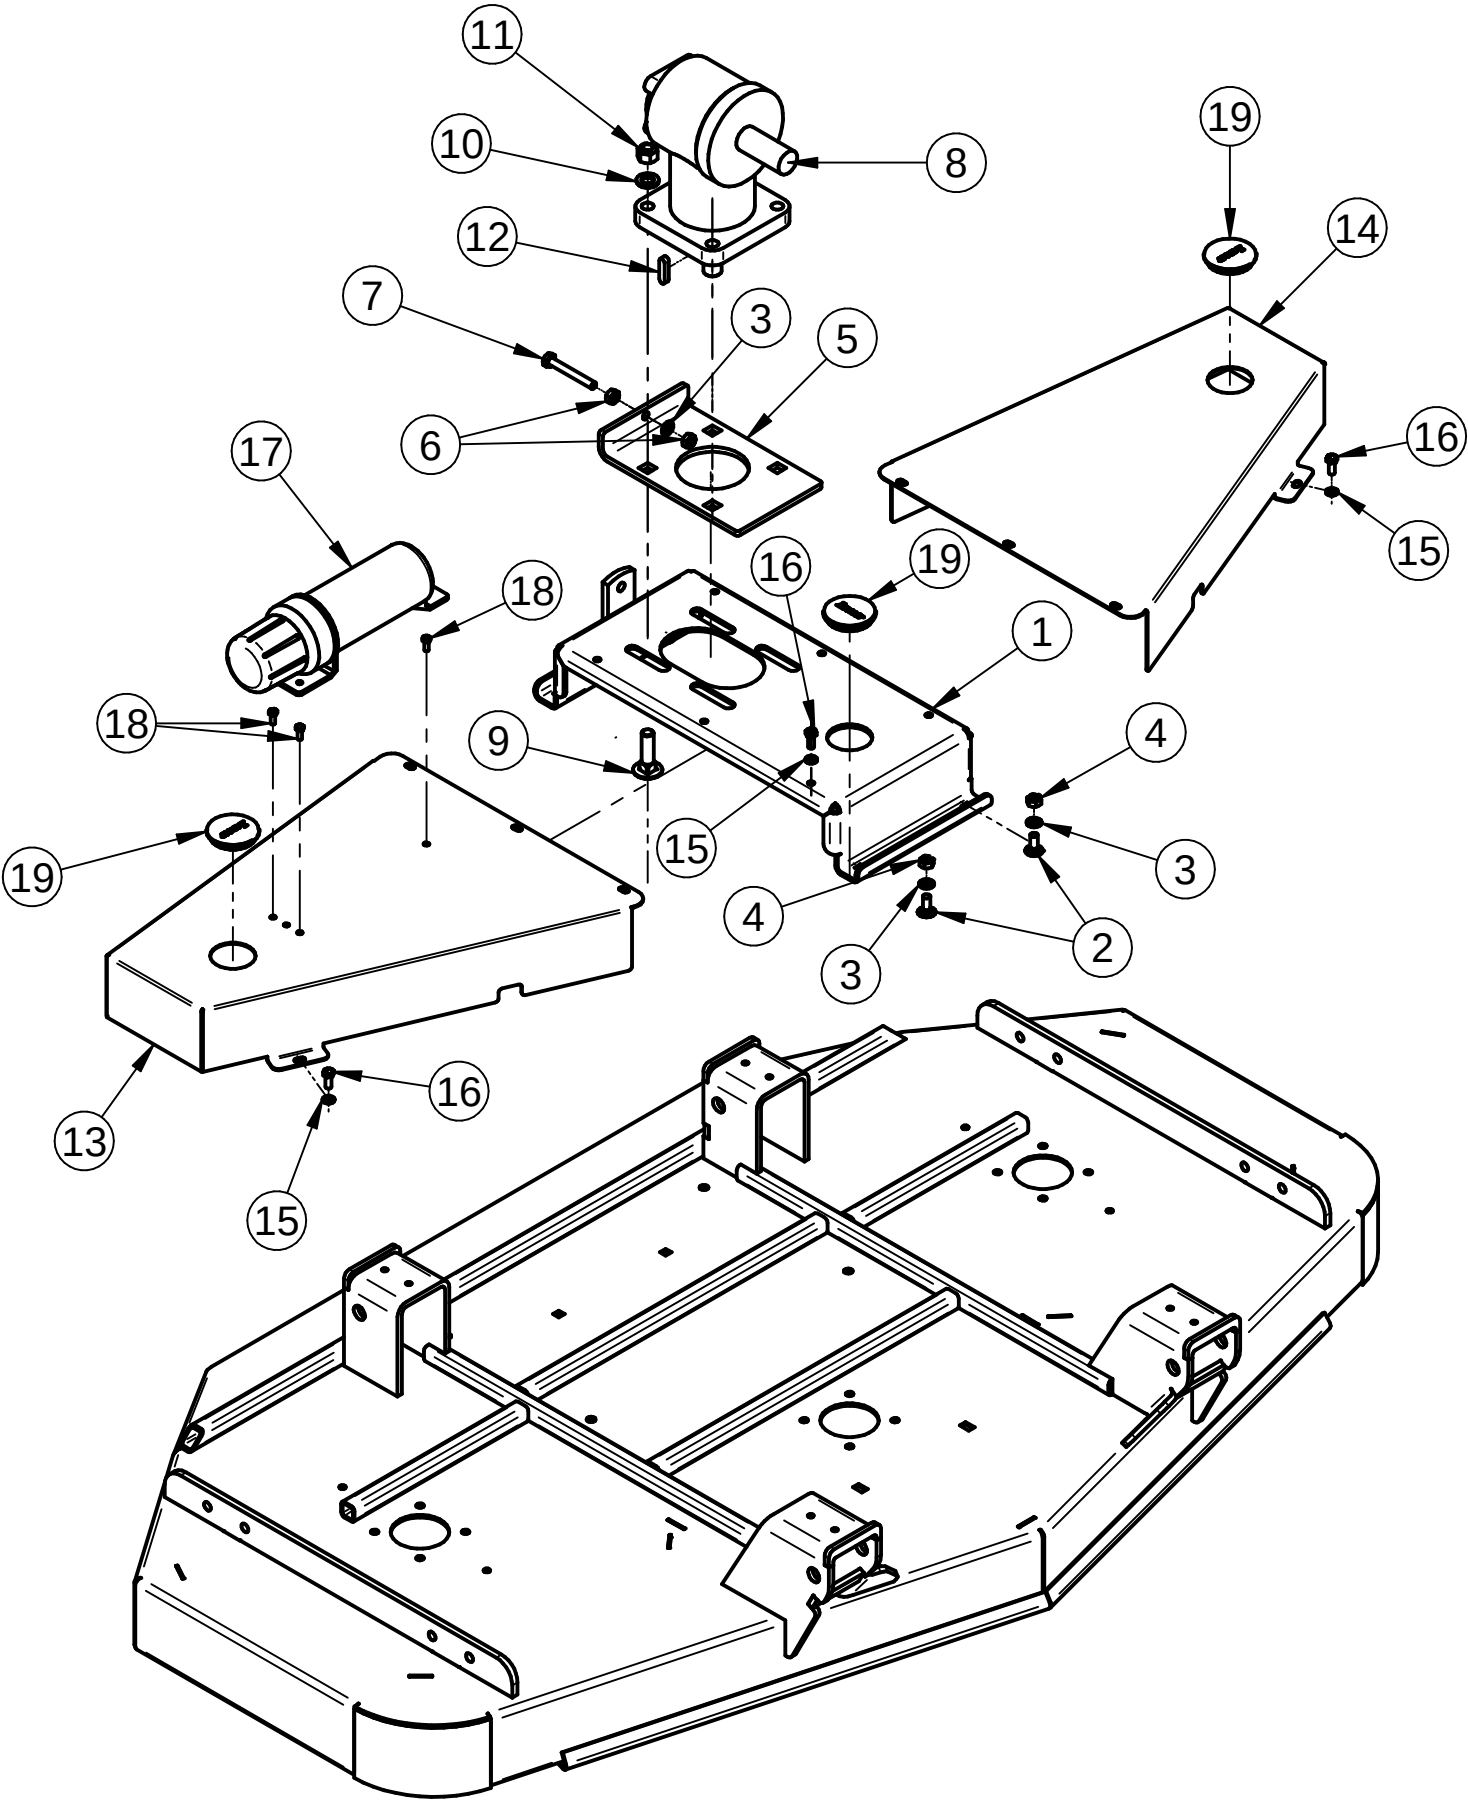

PART LIST FOR GEARBOX

Item No	Part No	Description	QTY
1	9183509	OIL SEAL 35 X 62 X 8	1
2	9162011	Internal Circlip HD 62 x 2.5 D472	1
3	9150008	6207 Z Deep Groove Ball Bearing	3
4	9161013	Internal Circlip 72 x 2.5 D472	3
6	9101003	Hex Bolt M10 x 20 8.8 Zn D933	4
7	9141001	Spring Washer M10 Zn D127	4
9	9150019	6007 Z DEEP GROOVE BALL BEARING	1
10	9181004	Blind Seal 72 X 8	1
11	20001 300 035	SIMS (DIA 72 X 60)(0.50mm)	
12	20001 300 036	SIMS (DIA 72 X 60)(1mm)	
13	9191002	3-8 IN BSPT Oil Breathing Plug	1
14	20001 000 022	GEAR BOX HOUSING	1
15	921002	KEY 10 X 8 X 30	1
16	20001 000 023	SPACER	1
17	20001 300 037	GEARBOX TOP COVER GM	1
18	20001 000 024	GASKET TOP COVER GM	1
19	20001 000 028	DRIVE SHAFT	1
20	20001 000 029	BEVEL GEAR Z-34 TEETH	1
21	20001 000 030	BEVEL PINION SHAFT 12 TEETH	1
22	9183508	OIL SEAL 35 X 72 X 10 HMSA10 RG	1

PART LIST FOR GEARBOX

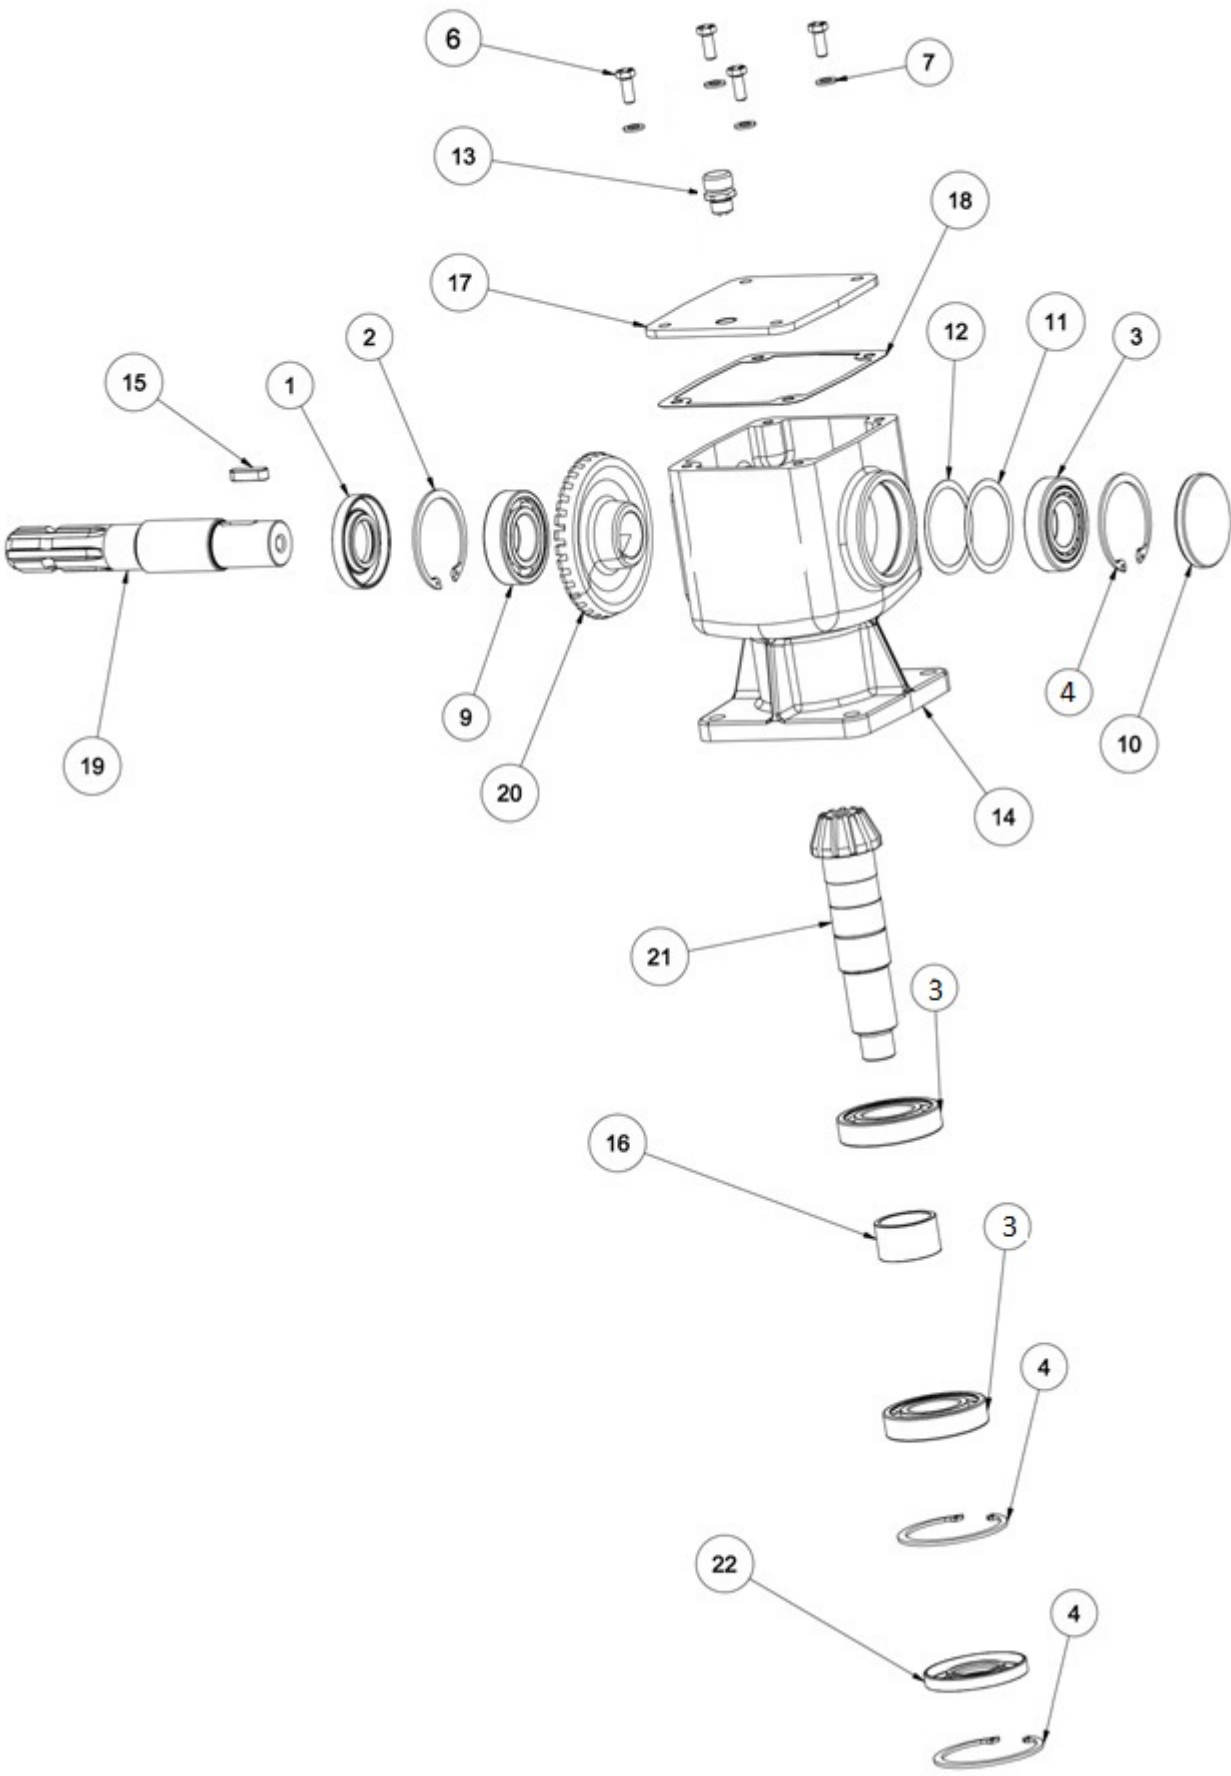

PART LIST FOR FRAME WITH BELT AND PULLEY

Item No	Part No	Description	QTY
1	20001 100 001	ROTOR HUB COMPLETE	3
2	20001 200 003	ROTOR HUB WA	3
3	9150003	6206 Deep Groove Ball Bearing	6
4	20001 000 008	BLADE DRIVE SHAFT	3
5	20001 000 006	SPACER OD 40 X ID 30.3 X 73 LG	3
6	20001 400 004	SPACER OD 40 X ID 30.3 X 4 THK	3
7	20001 000 007	DUST COVER FOR HUB	3
8	9101008	Hex Bolt M10 x 40 8.8 Zn D933	12
9	9141002	Washer M10 Zn D125A	12
10	9131002	Nylock Nut M10-8 Zp D982	12
11	20001 400 005A	BLADE GM 120	3
	20001 400 005B	BLADE GM 150	3
	20001 400 005C	BLADE GM 180	3
	20001 400 005D	BLADE GM 210	3
12	9141801	Spring Washer M18 Zn D127	3
13	9131803	Hex Nut M18X1.5-8 Zp D934	3
14	20001 000 009A	PULLEY 225 X SPB-2(GM-180,GM-210)	1
	20001 000 009B	PULLEY 250 X SPB-2(GM-120,GM-150)	1
15	20001 000 012	PARALLEL KEY 8 X 7 X 36	3
16	20001 000 010	PULLEY 130 X SPB-1	2
17	20001 000 011	PULLEY 130 X SPB-2	1
18	9133002	SLOTTED ROUND NUT M30 X 1.5 WITH POLYAMIDE INSERT DIN 1804.1	3
19	9192001	M8 x 1 Grease Nipple	7
20	20001 200 004	WHEEL SUPPORT ARM WA	4
21	9111207	Hex Bolt M12 x 80 HT 8.8 Zn D931	8
22	9141202	Washer M12 Zn D125A	8
23	9131202	Nylock Nut M12-8 Zp D982	8
24	20001 100 002	WHEEL UNIT COMPLETE	4
25	20001 200 005	WHEEL HOLDING BRACKET WA	4
26	20001 000 016	WHEEL 210 OD X 80 WIDTH WITH BEARING	4
27	20001 000 017	WHEEL DRIVE HOUSING	4
28	20001 400 006	SPACER OD 35 X ID 25.5 X 12 THk	40
29	9111215	Hex Bolt M12 x 140HT 8.8 Zn D931	4
30	9131202	Nylock Nut M12-8 Zp D982	4
31	9170801	Linch Pin 8 x 45	4
32	9195003	BELT SPB 60 17 X 1568 Li GM 120	2
	9195004	BELT SPB 68 17 X 1770 Li GM 150	2
	9195002	BELT SPB 74 17 X 1880 Li GM 180	2
	9195005	BELT SPB 94 17 X 2085 Li GM 210	2
33	20001 000 021	PARALLEL KEY A 10 X 8 X 40	1

PART LIST FOR FRAME WITH BELT AND PULLEY

